

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0009 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sutter County, Feather River	Right	6.25	04/19/2017 04/19/2017	Sterling York

LM Start		Rating **	A	Issue No.	<b>4</b>
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_LD0009_01_s_2013_4				
Comment Code					
Inspector Comment					
LD 9 has flood fight supplies on hand and coordinates with other local levee districts in the flood fight supply staging program.					

No Photos

LM Start		Rating **	A	Issue No.	<b>5</b>
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_LD0009_01_s_2013_5				
Comment Code					
Inspector Comment					
The levee district has stated in the past that they have a copy of the O&M manuals.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0009 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sutter County, Feather River	Right	6.25	04/19/2017 04/19/2017	Sterling York

LM Start		Rating **	A	Issue No.	6	
LM End		Issue Type +	Ma	Location *	CR	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Flood Preparedness & Training				o	
					o	
DWR ID	DWR_LD0009_01_s_2013_6					
Comment Code						
Inspector Comment						
The district has attended the Flood Fight class put on by RD 784 and DWR.						

No Photos

LM Start	0.02	Rating **	M	Issue No.	1
LM End	6.25	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.169117 °	39.255839 °
				-121.622620 °	-121.636402 °
DWR ID	DWR_LD0009_01_s_2017_1				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual grasses need to be maintained, Spring 2017.					

Photo 1 of 1 : SP\_2017\_LD0009\_202\_1\_20170426\_00006.jpg



View looking upstream of annual grasses that need to be maintained, Spring 2017.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0009 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sutter County, Feather River	Right	6.25	04/19/2017 04/19/2017	Sterling York

LM Start	0.02	Rating **	M	Issue No.	2
LM End	6.25	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.169117 °	39.255839 °
				-121.622620 °	-121.636402 °
DWR ID	DWR_LD0009_01_s_2017_2				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual grasses need to be maintained, Spring 2017.					

Photo 1 of 1 : SP\_2017\_LD0009\_202\_2\_20170426\_00007.jpg



View looking downstream of annual grasses that need to be maintained, Spring 2017.

LM Start	0.09	Rating **	A/W	Issue No.	18
LM End	0.09	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.170064 °	39.170064 °
				-121.622563 °	-121.622563 °
DWR ID	DWR_LD0009_01_f_2016_18				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
No animal activity. Rodent holes need to be backfilled. Spring 2017.					

Photo 1 of 1 : SP\_2017\_LD0009\_202\_18\_20170316\_00003.jpg



View of rodent holes that need to be backfilled, no sign of rodents at time of inspection. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0009 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sutter County, Feather River	Right	6.25	04/19/2017 04/19/2017	Sterling York

LM Start	5.32	Rating **	C	Issue No.	19
LM End	5.32	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.242582 °	39.242582 °
				-121.637032 °	-121.637032 °
DWR ID	DWR_LD0009_01_f_2015_19				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
This rodent site has been repaired by the LMA and there is no new evidence of rodent activity at this location. The picture was taken during the 2015 Fall Inspection.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---